

Utfärdare Issued by Aussteller	Bertil Nyström	Datum Date Datum	2006-07-06	Produkt Product Produkt	Scando hoist accessories
Från maskin nr. From machine No. Von Maschine Nr.	-	Till To Zu	-	Berör/Concerns/Betrifft	Vertical pipe joint

Part No. 0385436-SUB

It is important that the joints for the vertical pipes are in good condition.

If not, the joints may break or the mounting and dismantling may take much longer time.

Recommendations:


- Check the main dimensions
- Check possible deformations
- Ensure that threads on screw and clamp-half are not damaged
- Check that surface treatment on screw and clamp halves is OK.
- Grease and oil thread on screw and clamp half

If the components do not have the right dimensions, are damaged or corroded, the entire component shall be scrapped.

See sketch below for dimensions:

Please forward this instruction to all people concerned before inserting it in your Service Manual under index 2, Service Instructions!

Form approved by Anders Nilsson, After Sales Manager. Date: 2005-02-28

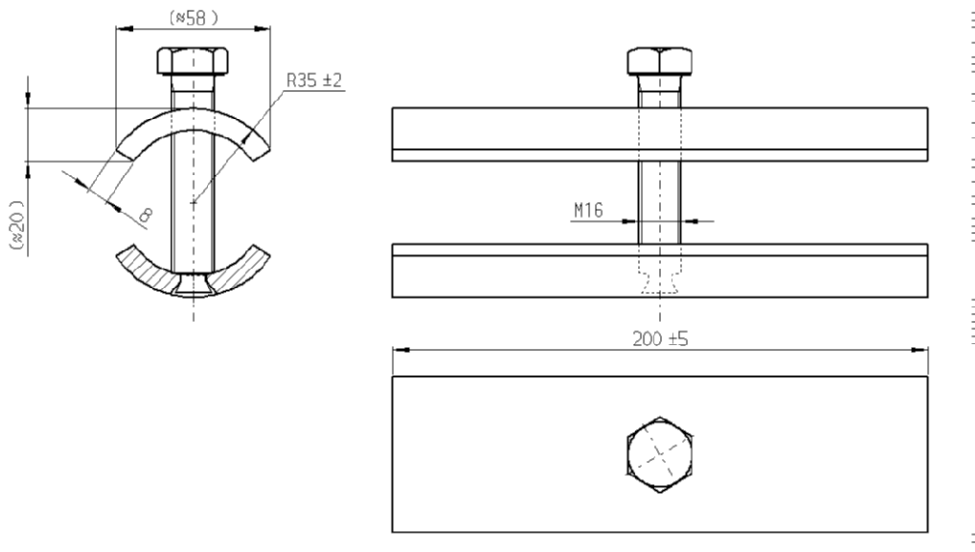

Please forward this instruction to all people concerned before inserting it in your Service Manual under index 2, Service Instructions!

Form approved by Anders Nilsson, After Sales Manager. Date: 2005-02-28