

**SERVICE INSTRUCTION MS 6/99E Rev A**

Utfärdare Issued by Aussteller <b>Bertil Nyström</b>	Datum Date Datum <b>1999-11-22</b> <b>Rev 2005-08-29</b>	Produkt Product Produkt <b>Scando Super FC / C</b>
Från maskin nr. From machine No. <b>All</b> Von Maschine Nr.	Till To - Zu	Berör/Concerns/Betrifft <b>Splines connection between motor and gear box</b>

**This revision replaces Service Instruction MS 6/99E dated 1999-11-22.**

**To avoid initial corrosion and later wear of splines connection between motor shaft and gear box, the motor shall be dismantled and the outer splines on motor shaft and the inner splines on the gear box pinion shall be greased with high quality grease.**


**O-ring 34 X 3 mm shall also be changed**

**Grease type Shell SRS 4000**

**Greasing interval every 24 months**

**Motor (Part No. 3002157-002)**

**Gear box (Part No. 3002157-025)**

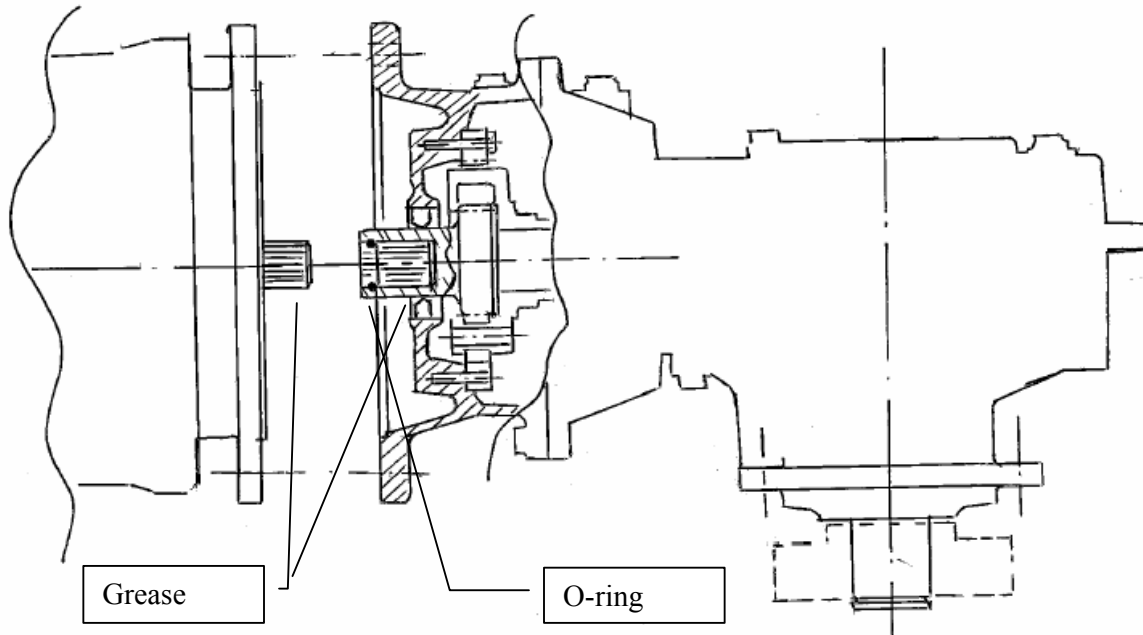

*Please forward this instruction to all people concerned before inserting it in your Service Manual under index 2, Service Instructions!*

*Form approved by Anders Nilsson, After Sales Manager. Date: 2005-02-28*